(X1) PROVIDER/SUPPLIER/CLIA STATEMENT OF DEFICIENCIES (X2) MULTIPLE CONSTRUCTION (X3) DATE SURVEY AND PLAN OF CORRECTION **IDENTIFICATION NUMBER:** COMPLETED A. BUILDING: 01 B. WING HAL097014 02/06/2015 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 176 REST HOME ROAD **WILKES COUNTY ADULT CARE** WILKESBORO, NC 28697 SUMMARY STATEMENT OF DEFICIENCIES PROVIDER'S PLAN OF CORRECTION (X4) ID (X5) COMPLETE (EACH CORRECTIVE ACTION SHOULD BE (EACH DEFICIENCY MUST BE PRECEDED BY FULL PRÉFIX **PREFIX** DATE REGULATORY OR LSC IDENTIFYING INFORMATION) CROSS-REFERENCED TO THE APPROPRIATE TAG TAG DEFICIENCY) C 000 Initial Comments C 000 This report is of a Biennial Construction Survey done by Bob Getchell and Dennis Harrell on February 6, 2015. This facility was first licensed as a Home for the Aged serving 99 residents on 12-1-1962. Therefore the facility was surveyed for conformance with the 1971 and the applicable portions of the 2005 Rules for the Licensing of Adult Care Homes, and, the 1967 North Carolina State Building Code, Group D. Deficiencies were noted which will require a new plan of correction. C 101 C 101 Existing Licensed Fac- No less than '71 Rules SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0301 APPLICATION OF PHYSICAL PLANT REQUIREMENTS The physical plant requirements for each adult care home shall be applied as follows: (2) Except where otherwise specified, existing licensed facilities or portions of existing licensed facilities shall meet licensure and code requirements in effect at the time of construction, change in service or bed count, addition, renovation, or alteration; however in no case shall the requirements for any licensed facility where no addition or renovation has been made, be less than those requirements found in the 1971 "Minimum and Desired Standards and Regulations" for "Homes for the Aged and Infirm", copies of which are available at the Division of Health Service Regulation, 701 Barbour Drive, Raleigh, North Carolina, 27603 at no cost; This Rule is not met as evidenced by: 1. Based on observation, the building was not

Division of Health Service Regulation

LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE

TITLE (X6) DATE

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:) DATE SURVEY COMPLETED	
		HAL097014	B. WING		02/0	6/2015	
NAME OF F	PROVIDER OR SUPPLIER			STATE, ZIP CODE			
WILKES	COUNTY ADULT CAF	₹ F	HOME ROA				
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES		ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)		(X5) COMPLETE DATE	
C 101	Continued From pa	ge 1	C 101				
	maintained in a safe manner by not maintaining the fire-resistance rating of building components. This would effect all residents by not containing smoke and fire in the room or smoke compartment of origin.						
	Findings on 02/06/2015: a. The center attic between the firewalls is 9660 square feet. Unsprinklered attics are required to be subdivided into 3000 square foot draft compartments. Consult with the local building official for guidance, and to obtain any permits needed.						
	b. The cross corrid Hall is not closing of	lor door between 400 and 500 completely					
	protection equipme safe manner. This	vation, the building fire nt was not maintained in a would effect all residents by e and activating the fire alarm.					
	Findings 02/06/201 a. The heat detector closet has been rem	or in the 100 Hall storage					
C 160	Outside Premises-0	Clean, Safe	C 160				
	(1) The outside gro						
	This Rule is not me 1. Based on observ	et as evidenced by: vation, egress from all areas					

Division of Health Service Regulation STATE FORM

6899 62JP21 If continuation sheet 2 of 6

		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01		(X3) DATE SURVEY COMPLETED	
		HAL097014	B. WING		02/	06/2015
	PROVIDER OR SUPPLIER COUNTY ADULT CAR	176 REST	DRESS, CITY, S HOME ROA ORO, NC 28			
(X4) ID PREFIX TAG	(EACH DEFICIENCY	TEMENT OF DEFICIENCIES ' MUST BE PRECEDED BY FULL SC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRE (EACH CORRECTIVE ACTION SHO CROSS-REFERENCED TO THE APP DEFICIENCY)	OULD BE	(X5) COMPLETE DATE
C 160	was not maintained ramp with missing he residents by not allow emergency. Findings on 02/06/2	in a safe manner by having a nandrail. This would effect all bwing safe egress in an 2015:	C 160			
C 189	SECTION .0300 - F 10A NCAC 13F .03 REQUIREMENTS (a) The building an mechanical, and plu care home shall be operating condition (k) This Rule shall facilities with the ex	11 OTHER d all fire safety, electrical, umbing equipment in an adult maintained in a safe and	C 189			
	maintained in a safe the fire-resistance of This would effect all smoke and fire in the compartment of original Findings on 02/06/2 a. The two attic fire an unidentified seal firestopping material	vation, the building was not be manner by not maintaining rating of building components. I residents by not containing the room or smoke gin. 2015: walls have been sealed with lant. Seal with an approved all that is part of a fire stop				
		corridors there are unprotected ceiling above the wi-fi				

Division of Health Service Regulation STATE FORM

DIVISION	of Fleatill Service 136	guiation				
STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA		(X2) MULTIPLE CONSTRUCTION (X3) DATE				
AND PLAN OF CORRECTION IDENTIFICATION NUMBER:		A. BUILDING: 01		COMPLETED		
		HAL097014	B. WING		02/0	6/2015
NAME OF PROVIDER OR SUPPLIER STREET ADI			DRESS, CITY S	STATE, ZIP CODE		
		176 RFST	HOME ROA			
WILKES	COUNTY ADULT CAP	₹ F	ORO, NC 2			
(X4) ID	SUMMARY STA	TEMENT OF DEFICIENCIES	ID	PROVIDER'S PLAN OF CORRECTION	ON	(X5)
PREFIX	(EACH DEFICIENCY	/ MUST BE PRECEDED BY FULL	PREFIX	(EACH CORRECTIVE ACTION SHOUL	D BE	COMPLETE
TAG	REGULATORY OR L	SC IDENTIFYING INFORMATION)	TAG	CROSS-REFERENCED TO THE APPROF DEFICIENCY)	PRIATE	DATE
C 189	Continued From pa	ge 3	C 189			
	modems.					
	c. Room 308 has w	all damage behind the door				
	d Rath/shower room	m at room 305 has wall				
	damage behind the					
	damage bermid and	. 4001				
	e. There are holes i	in the ceiling of the 600 Hall				
	storage closet.					
	f The selling of the					
	t. The ceiling of the	electrical room is damaged.				
	g. There are holes	in the ceiling of the 200 Hall				
	linen closet.	a.e eeg e. a.e 200 . a				
	Seal with an approved firestopping material that					
	is part of a fire stop system that meets ASTM					
	E-814.					
	2 Based on observ	vation, the building was not				
		e manner because there are				
		srepair. This would effect all				
	residents by not res	sisting the passage of smoke.				
	Finding 00/00/0	2045				
	Findings on 02/06/2 a. 400 Hall shower					
	a. 400 Hall Showel	door will not laten				
	b. 400 Hall shower	door has holes in the door at				
	the lock.					
		r to the dining room will not				
	latch.					
	d. Room 101 door	will not latch				
	A The small dining	g room door is missing the				
	strike plate.	, room door is missing the				
	·					
	f. The door to the o	dining room was wedged open.				

Division of Health Service Regulation STATE FORM

DIVISION	of Health Service Re	guiation	T		T	
STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA		(X2) MULTIPLE CONSTRUCTION		(X3) DATE SURVEY		
AND PLAN OF CORRECTION IDENTIFICATION NUMBER:		A. BUILDING: 01		COMPLETED		
		HAL097014	B. WING		02/0	6/2015
NAME OF F	PROVIDER OR SUPPLIER	STREET AD	DRESS, CITY, S	STATE, ZIP CODE		
		176 RFST	HOME ROA			
WILKES	COUNTY ADULT CAP	₹ F	ORO, NC 2			
(X4) ID	SUMMARY STA	TEMENT OF DEFICIENCIES	ID	PROVIDER'S PLAN OF CORRECTION	ON.	(X5)
PREFIX	(EACH DEFICIENCY	/ MUST BE PRECEDED BY FULL	PREFIX	(EACH CORRECTIVE ACTION SHOUL	.D BE	COMPLETE
TAG	REGULATORY OR L	SC IDENTIFYING INFORMATION)	TAG	CROSS-REFERENCED TO THE APPRO DEFICIENCY)	PRIATE	DATE
				,		
C 189	Continued From pa	ige 4	C 189			
	g. The doors to the wedged open.	e administrative offices were				
	wedged open.					
	h. Room 308 has a	a loose door handle.				
	i. The living room o	door at room 303 was propped				
	open with a chair.					
	3. Based on obser	vation, the building was not				
		e manner because a toilet is				
	coming loose from the floor. This would effect all					
	residents using the hall toilet by exposing them to					
	leaks from a broker	n wax seal.				
	Findings on 02/06/2015::					
	The bath/shower room near room 305 has a toilet coming loose from the floor. Secure.					
	4. Passed on observation the building emergency					
	4. Based on observation, the building emergency equipment was not maintained in a safe manner.					
		Il residents by not providing				
		exits during a power outage.				
	Fig. 11: 22 22 00/00/0	2045.				
	Findings on 02/06/2					
	305 is not working.	light in the corridor at room				
	505 is not working.					
	5. Based on observ	vation, the building plumbing				
		maintained in a safe manner				
		onnects. This would effect all				
		ially siphoning waste water				
	into the potable wat	ter system.				
	Findings on 02/06/	2015:				
	Findings on 02/06/2	the Beauty Shop sink has no				
		nstall vacuum breaker on				
	beauty shop sink sp					
	acadi, chop on it of	,				

6899

Division of Health Service Regulation STATE FORM

62JP21 If continuation sheet 5 of 6

STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA					3) DATE SURVEY	
AND PLAN OF CORRECTION IDENTIFICATION NUMBER:		A. BUILDING: 01		COMPLETED		
		HAL097014	B. WING		02/0	6/2015
NAME OF PROVIDER OR SUPPLIER STREET ADD			DDRESS, CITY, STATE, ZIP CODE			
WII KES	COUNTY ADULT CAR	176 REST	HOME ROA	ND.		
WILKES	COUNTY ADDET CAN	WILKESB	ORO, NC 28	3697		
(X4) ID PREFIX TAG	(EACH DEFICIENCY		ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOUL CROSS-REFERENCED TO THE APPROFILIENCY)	D BE	(X5) COMPLETE DATE
C 199	Continued From pa	ge 5	C 199		_	
C 199	Exhaust Ventilation		C 199			
	(EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION) Continued From page 5 Exhaust Ventilation SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0311 OTHER REQUIREMENTS (g) The spaces listed in this Paragraph shall be provided with exhaust ventilation at the rate of two cubic feet per minute per square foot. This requirement does not apply to facilities licensed before April 1, 1984, with natural ventilation in these specified spaces: (1) soiled linen storage; (2) soil utility room; (3) bathrooms and toilet rooms; (4) housekeeping closets; and (5) laundry area. (k) This Rule shall apply to new and existing facilities with the exception of Paragraph (e) which shall not apply to existing facilities. This Rule is not met as evidenced by: 1. Based on observation, the building exhaust ventilation was not maintained in accordance with this Rule. Findings on 02/06/2015:: The hoousekeeping closet accross from room 603 has no exhaust fan.					

6899

Division of Health Service Regulation STATE FORM